HONDA Service Bulletin

| Model | Applicable To | File Under | Bulletin No. |
|---|---|---|---|
| 1992 and Later NEW | ALL except PASSPORT NEW | BODY | 93-033 |

Issue Date
JUNE 3, 1996

# Broken Seat Belt Tongue Stopper Button

**(Supersedes 93-033, dated October 22, 1993)**

## PROBLEM

The seat belt tongue stopper button is broken, allowing the tongue to slide down to the floor.

## CORRECTIVE ACTION

Install a new seat belt tongue stopper button listed under PARTS INFORMATION.

1. Slide the seat belt tongue up the seat belt past the tongue stopper button hole. Temporarily secure the seat belt tongue to the belt fabric with masking tape.
2. Insert the male section of the button through the hole in the belt fabric. Align and install the female section of the stopper to the male section.

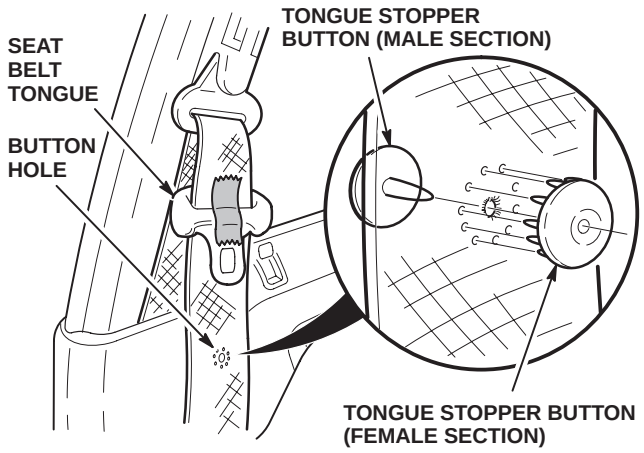


3. Preset the closed gap on a pair of vise-grip pliers to 4.5 mm.

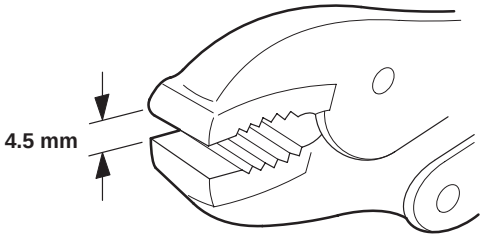


4. Place the flat portion of the jaws over the tongue stopper, and squeeze until the vise-grip jaws lock and deform the stopper shaft.

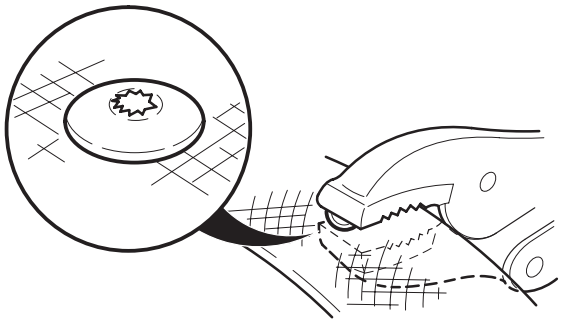

## PARTS INFORMATION

Seat Belt Tongue Stopper:

| Color | P/N | H/C |
|---|---|---|
| Black | 04814-SP0-305 ZA | 4434718 |
| Red | 04814-SP0-305 ZB | 4434726 |
| Taupe | 04814-SP0-305 ZC | 4434734 |
| Ivory | 04814-SP0-305 ZD | 4434742 |
| Green | 04814-SP0-305 ZE | 4693651 |

NEW

## WARRANTY CLAIM INFORMATION

**Warranty Coverage:**
Seat belts that fail to function properly during normal use are covered under warranty for the useful life of the car.

**Warranty Does Not Cover:**

- Malfunction due to abuse, alteration, accidental damage or damage resulting from a collision or misuse.
- Replacement of a properly functioning seat belt for cosmetic or comfort reasons.

| | |
|---|---|
| Operation number: | 854125 |
| Flat rate time: | 0.2 hour (one or two sides) |
| Failed part: | P/N 04814-SM1-A02ZA<br>H/C 3919289 NEW |
| Defect code: | L18 |
| Contention code: | A02 |

© 1996 American Honda Motor Co., Inc. – All Rights Reserved


**CUSTOMER INFORMATION:** The information in this bulletin is intended for use *only* by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your car. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your car, or that your car has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.